

FORM  
INSPRev  
X/15

## State of Colorado Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203  
Phone: (303) 894-2100 Fax: (303) 894-2109



Inspection Date:

04/24/2020

Submitted Date:

04/28/2020

Document Number:

698100148

### FIELD INSPECTION FORM

Loc ID 416157 Inspector Name: Arauza, Steven On-Site Inspection  2A Doc Num: \_\_\_\_\_

**Status Summary:**

- THIS IS A FOLLOW UP INSPECTION  
 FOLLOW UP INSPECTION REQUIRED  
 NO FOLLOW UP INSPECTION REQUIRED

**Operator Information:**

OGCC Operator Number: 10456  
 Name of Operator: CAERUS PICEANCE LLC  
 Address: 1001 17TH STREET #1600  
 City: DENVER State: CO Zip: 80202

**Findings:**

- 9 Number of Comments  
6 Number of Corrective Actions  
 Corrective Action Response Requested

**ANY CORRECTIVE ACTION(S) FROM  
PREVIOUS INSPECTIONS THAT HAVE NOT  
BEEN ADDRESSED ARE STILL APPLICABLE**

**Contact Information:**

Contact Name	Phone	Email	Comment
Fischer, Alex		alex.fischer@state.co.us	
Janicek, Jake		JJanicek@caerusoilandgas.com	EHS Professional
Trujillo, Aaron		aaron.trujillo@state.co.us	
Pesicka, Conor		conor.pesicka@state.co.us	
,		COGCC.inspections@caerusoilandgas.com	All Inspections

**Inspected Facilities:**

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
456518	LAND APPLICATION SITE	CL	10/09/2018		-	Puckett 697-26A land treatment	EI

**General Comment:**

COGCC Environmental Inspection conducted along with COGCC Reclamation Specialist A. Trujillo. Follow-up to Remediation Project #11653.

See Field Inspection Report doc #696201205 for observations and corrective actions related to COGCC Reclamation requirements.

**Location**

Overall Good:

Emergency Contact Number:

Comment:

Corrective Action:

Date: \_\_\_\_\_

**Good Housekeeping:**

Type	TRASH		
Comment:	Trash observed along land treatment unit berms on west and north sides. See photos.		
Corrective Action:	Comply with Rule 603.f. (trash)	Date:	05/15/2020
Type	STORAGE OF SUPL		
Comment:	Multiple hoses observed inside of secondary containment area. See photos.		
Corrective Action:	Comply with Rule 603.f. (hoses)	Date:	05/15/2020
Type	DEBRIS		
Comment:	Wood debris stored inside southeast corner of tank battery secondary containment area. See photos.		
Corrective Action:	Comply with Rule 603.f (wood debris)	Date:	05/15/2020

Overall Good:

**Spills:**

Type	Area	Volume	
Other		<= 1 bbl	
Comment:	Stained soil with hydrocarbon odor observed at culvert outlet on north side of pad. See photos. Operator was notified of this issue via phone on 4/24/2020.		
Corrective Action:	Control and contain spills/releases and clean up per Rule 906.a. Remove and properly dispose of oily waste, per Rule 907.e.		Date: 05/24/2020

In Containment: No

Comment:

Multiple Spills and Releases?

**Tanks and Berms:**

Contents	#	Capacity	Type	Tank ID	SE GPS
OTHER	9	400 BBLs	STEEL AST		,
Comment:					
Corrective Action:					Date:

**Paint**

Condition:

Other (Content) 6 produced water ASTs, 3 condensate ASTs

Other (Capacity)

Other (Type)

**Berms**

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Metal	Adequate			

Comment:	Lined secondary containment area contained approximately 2" of fluids that had been impacted by localized accumulations of hydrocarbons. During inspection condensate and hydrocarbon odors were observed on top of fluids in southeast corner of tank battery. No holes or tears were observed in visible portions of liner. See photos.	
Corrective Action:	Remove and properly dispose of oily waste, per Rule 907.e.	Date: 05/15/2020

**Venting:**

Yes/No			
Comment:			
Corrective Action:		Date:	

**Flaring:**

Type		
Comment:		
Corrective Action:		Date:

**Inspected Facilities**

Facility ID: 456518 Type: LAND API Number: - Status: CL Insp. Status: EI

**Environmental**

**Waste Management:**

Type	Management	Condition	GPS (Lat)	(Long)
Drill Cuttings	Land Treatment	Inadequate		
Comment	Operator's approved Beneficial Reuse Sundry (doc #402163214) describes placement of approximately 6,656 cubic yards of remediated cuttings on a cut slope on the east side of the pad (doc #402169168) as part of interim reclamation, with a proposed start date of 11/1/2019. On inspection date, cuttings were observed on east, south, and west sides of the pad primarily remaining in a land treatment unit documented under Remediation Project #11653. Cuttings had not been covered by native soil for stabilization, as described in approved Beneficial Reuse Sundry, prior to inspection date. See photos.			
Corrective Action	Comply with corrective actions listed on Field Inspection Report #696201205.			Date: _____

**Spill/Remediation:**

Comment: \_\_\_\_\_

Corrective Action: \_\_\_\_\_ Date: \_\_\_\_\_

Emission Control Burner (ECB): \_\_\_\_\_

Comment: \_\_\_\_\_

Pilot: \_\_\_\_\_ Wildlife Protection Devices (fired vessels): \_\_\_\_\_

**Attached Documents**

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
402383710	INSPECTION SUBMITTED	<a href="http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5135689">http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5135689</a>
698100150	20200424 field photos	<a href="http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5135686">http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5135686</a>