

FORM

6

Rev  
11/20

## State of Colorado

## Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE

ET

OE

ES

Document Number:

402532855

Date Received:

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Valerie Danson

Name of Operator: PDC ENERGY INC

Phone: (970) 506-9272

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: valerie.danson@pdce.com

For "Intent" 24 hour notice required,

Name: Serna, Abe

Tel: (720) 661-7317

COGCC contact:

Email: abe.serna@state.co.us

Type of Well Abandonment Report: ☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

API Number 05-123-14919-00

Well Name: DEVOTIE

Well Number: 2-6

Location: QtrQtr: SWSE Section: 6 Township: 4N Range: 65W Meridian: 6

County: WELD

Federal, Indian or State Lease Number: 63153

Field Name: WATTENBERG

Field Number: 90750

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.336210

Longitude: -104.703650

GPS Data: GPS Quality Value: 2.5 Type of GPS Quality Value: Date of Measurement: 07/21/2006

Reason for Abandonment: ☐ Dry ☒ Production Sub-economic ☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes ☐ No Estimated Depth: 2500Fish in Hole: ☐ Yes ☒ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details:

## Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
NIOBRARA-CODELL	6855	7180			

Total: 1 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J55	24	0	370	330	370	0	VISU
1ST	7+7/8	4+1/2	J55	11.6	0	7302	728	7302	3634	CBL

Subsurface hazards include, but are not limited to, the following: overpressured zones, underpressured zones, major geologic faults, salt sections, H2S at concentrations greater than or equal to 100 ppm.

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6805 with 2 sacks cmt on top. CIPB #2: Depth 4254 with 2 sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIPB #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 100 sks cmt from 2550 ft. to 2300 ft. Plug Type: STUB PLUG Plug Tagged: ☐  
Set 100 sks cmt from 1460 ft. to 1260 ft. Plug Type: OPEN HOLE Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 225 sacks half in. half out surface casing from 570 ft. to 0 ft. Plug Tagged: ☒

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

## Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing

Surface Plug Setting Date: \_\_\_\_\_ Cut and Cap Date: \_\_\_\_\_ Number of Days from Setting Surface Plug to Capping or Sealing the Well: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

Devotie 2-6 (05-123-14919) Plugging Procedure (Intent)  
Producing Formation: Niobrara/Codell: 6855'-7180'

Upper Pierre Aquifer: 350'-1360'  
TD: 7302' PBD: 7243' (1/10/2007)  
Surface Casing: 8 5/8" 24# @ 370' w/ 330 sxs  
Production Casing: 4 1/2" 11.6# @ 7302' w/ 728 sxs cmt (TOC @ 3634' – CBL)

Tubing: 2 3/8" tubing set @ 7146' (11/7/2017)

Proposed Procedure:

1. MIRU pulling unit. Pull 2 3/8" tubing.
2. RU wireline company.
3. TIH with CIBP. Set BP at 6805'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Nio perfs @ 6855')
4. TIH with CIBP. Set BP at 4254'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Sussex @ 4304')
5. TIH with casing cutter. Cut 4 1/2" casing at 2500'. Pull cut casing.
6. TIH with tubing to 2550'. RU cementing company. Mix and pump 100 sxs 15.8#/gal CI G cement down tubing. (Stub plug from 2550'-2300').
7. TIH with tubing to 1460'. Mix and pump 100 sxs 15.8#/gal CI G cement down tubing. (Pierre Coverage from 1460'-1260').
8. Pick up tubing to 570'. Mix and pump 225 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface (Pierre coverage from 570'-surface).
9. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Valerie Danson  
Title: Reg Tech Date: \_\_\_\_\_ Email: valerie.danson@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_ Date: \_\_\_\_\_

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_ Expiration Date: \_\_\_\_\_

COA Type	Description
----------	-------------

--	--

**Attachment Check List**

Att Doc Num	Name
-------------	------

402532856	WELLBORE DIAGRAM
402532857	WELLBORE DIAGRAM

Total Attach: 2 Files

**General Comments**

User Group	Comment	Comment Date
------------	---------	--------------

		Stamp Upon Approval
--	--	---------------------

Total: 0 comment(s)