

**FORM
INSP**Rev
X/20

State of Colorado

Oil and Gas Conservation Commission

 1120 Lincoln Street, Suite 801, Denver, Colorado 80203
 Phone: (303) 894-2100 Fax: (303) 894-2109


Inspection Date:

12/07/2022

Submitted Date:

12/15/2022

Document Number:

694100034**FIELD INSPECTION FORM**
 Loc ID _____ Inspector Name: _____ On-Site Inspection ☐
 Robinson, Taylor _____ 2A Doc Num: _____
Operator Information:OGCC Operator Number: 10773Name of Operator: FUNDARE RESOURCES OPERATING COMPANY LLCAddress: 5251 DTC PKWY STE 950City: GREENWOOD State: CO Zip: 80111**Status Summary:**

- ☐ THIS IS A FOLLOW UP INSPECTION
- ☒ FOLLOW UP INSPECTION REQUIRED
- ☐ NO FOLLOW UP INSPECTION REQUIRED

Findings:7 Number of Comments4 Number of Corrective Actions☒ Corrective Action Response Requested
**ANY CORRECTIVE ACTION(S) FROM
PREVIOUS INSPECTIONS THAT HAVE NOT
BEEN ADDRESSED ARE STILL APPLICABLE**
Contact Information:

Contact Name	Phone	Email	Comment
Linhardt, Cliff		clinhardt@fundareresources.com	DESIGNATED AGENT
Smith, Sydney		ssmith@fundareresources.com	Regulatory

General Comment:

This is an environmental inspection for Facility ID 483043 Fundare Wildhorse 04-0424H. Any corrective actions from previous inspections that have not been addressed are still applicable. There were no operator or contract environmental personnel on location at the time of this field inspection. Photos attached to document site conditions.

LocationOverall Good: ☐

Emergency Contact Number:

Comment: Downed signage at entranceCorrective Action: Install sign to comply with Rule 210.e.Date: 12/22/2022**Good Housekeeping:**

Type OTHER

Comment: Inadequate
Stained soil adjacent to crude oil secondary containment near loadout area
Crude oil loadout secondary containment spill bucket has several inches of crude oil,
staining beneath spill bucket.
Staining below pumps in crude oil corrugated steel secondary containment dike
Staining in pumpjack shed
Linear holes along utility locates adjacent to wellhead

Corrective Action: Lack of maintenance/good housekeeping procedures - see above statement (see
photos). Comply with Rules 606 and 1002.f.(2).D.

Date: 12/22/2022Overall Good: ☐**Spills:**

Type Area Volume

In Containment: No

Comment: "Spill 481332 - Excavation activities have been initiated. No information has been provided since the Form
19i submitted on 12/29/2021.

Spill 483043 - Spill location and surrounding area has been surface scraped and grass/weeds have been
mowed. Stained soil was observed near flare earthen berm and adjacent fencing. Staining observed on
wooden fence post. "

☐ Multiple Spills and Releases?**Fencing/:**

Type

Comment: Spill 481332 - Open excavation around wellhead (~10'x15'x2.5') and is surrounded by
orange construction fencing. Orange construction fencing at is torn and has not been
properly installed.

Corrective Action: repair and maintain best management practices to control and contain all spills/releases
of E&P waste to protect the environment, public health, safety and welfare and the
environment as required by rule 913.b(5)B.i which requires that Operators will fence or
cover open remediation excavations to prevent access when sites are not attended. the
site was not attended at the time of the inspection.

Date: 12/22/2022**Venting:**

Yes/No

Comment:

Corrective Action:

Date:

Flaring:

Type

Comment:

Corrective Action:

Date:

Location Construction

Location ID: 483043 CDP: _____

Comment: _____

Corrective Action: _____ Date: _____

Form 2A COAs:

Comment: _____

Corrective Action: _____ Date: _____

Wildlife BMPs:

Comment: _____

Corrective Action: _____ Date: _____

Comment: _____

Corrective Action: _____ Date: _____

On Site Inspection (305):

Surface Owner Contact Information:

Name: _____ Address: _____

Phone Number: _____ Cell Phone: _____

Operator Rep. Contact Information:

Landman Name: _____ Phone Number: _____

Date Onsite Request Received: _____ Date of Rule 306 Consultation: _____

Request LGD Attendance: _____

LGD Contact Information:

Name: _____ Phone Number: _____ Agreed to Attend: _____

Summary of Landowner Issues:

Summary of Operator Response to Landowner Issues:

Onsite Inspection Memorandum Summarizing Discussions at Inspection as Attachment:

Environmental

Spills/Releases:

Type of Spill: _____	Estimated Spill Volume: _____
Comment: _____	
Corrective Action: _____	Date: _____
Reportable: _____	GPS: Lat _____ Long _____
Proximity to Surface Water: _____	Depth to Ground Water: _____

Water Well Complaint:

		Lat	Long
DWR Receipt Num: _____	Owner Name: _____	GPS : _____	_____

Field Parameters:

--

Sample Location: _____	Comment: _____
------------------------	----------------

Reclamation - Storm Water - Pit**Storm Water:**

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment

Comment: [Stormwater BMPs installed along the access road have not been maintained.](#)

Corrective Action: [Install new BMPs in accordance with 1002.f.\(2\) to prevent runoff and runoff and completely contain impacts along access road](#)

Date: 12/22/2022

Pits: ☐ NO SURFACE INDICATION OF PIT

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
403264815	INSPECTION SUBMITTED	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5951003
694100040	Photo log	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5950997