

DE	ET	OE	ES
Document Number: 401044954			
Date Received:			

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175 Contact Name: Jenifer Hakkarinen
 Name of Operator: PDC ENERGY INC Phone: (303) 8605800
 Address: 1775 SHERMAN STREET - STE 3000 Fax: _____
 City: DENVER State: CO Zip: 80203 Email: Jenifer.Hakkarinen@pdce.com

For "Intent" 24 hour notice required, Name: Pesicka, Conor Tel: (970) 415-0789
COGCC contact: Email: conor.pesicka@state.co.us

API Number 05-123-20061-00 Well Number: 33-29
 Well Name: J&L FARMS
 Location: QtrQtr: NWSE Section: 29 Township: 6N Range: 63W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: _____
 Field Name: WATTENBERG Field Number: 90750

Notice of Intent to Abandon Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.456140 Longitude: -104.457610
 GPS Data:
 Date of Measurement: 09/29/2008 PDOP Reading: 1.5 GPS Instrument Operator's Name: Holly L. Tracy
 Reason for Abandonment: Dry Production Sub-economic Mechanical Problems
 Other _____
 Casing to be pulled: Yes No Estimated Depth: 700
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6791	6799			
Total: 1 zone(s)					

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	390	275	390	0	VISU
1ST	7+7/8	4+1/2	10.5	6,994	380	6,994	3,494	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6760 with 2 sacks cmt on top. CIBP #2: Depth 6500 with 2 sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
(Cast Iron Cement Retainer Depth)

Set 300 sacks half in. half out surface casing from 750 ft. to 0 ft. Plug Tagged:

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 Yes No *ATTACH JOB SUMMARY

Technical Detail/Comments:

J&L Farms #33-29 (05-123-20061)/Plugging Procedure (Intent)
Producing Formation: Codell 6791'-6799'
TD: 7033' PBD: 6691'
Surface Casing: 8 5/8" 24# @ 390' w/ 275 sxs.
Production Casing: 4 1/2" 10.5# @ 6994' w/ 380 sks cmt (TOC 3494' CBL).

Tubing: 2 3/8" 4/7#/ft J-55 set at 6782.

Proposed Procedure:

1. MIRU RU pulling unit. Pull tubing.
2. RU wireline company. Run gyro survey from 6600' to surface.
3. TIH with CIBP. Set BP at 6760'. Top with 2 sxs 15.8#/gal CI G cement.
4. TIH with CIBP. Set BP at 6500'. Top with 2 sxs 15.8#/gal CI G cement.
5. TIH with casing cutter. Cut 4 1/2" casing at 700'. Recover 4 1/2" casing.
6. TIH with tubing to 750'. Mix and pump 300 sxs of 15.8#/gal CI G cement down tubing. Cement should circulate to surface.
7. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Jenifer Hakkarinen

Title: Reg Tech Date: _____ Email: Jenifer.Hakkarinen@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

