

FORM
6Rev
12/05State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

401104917

Date Received:

10/13/2016

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Jenifer Hakkarinen

Name of Operator: PDC ENERGY INC

Phone: (303) 8605800

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: Jenifer.Hakkarinen@pdce.com

For "Intent" 24 hour notice required,

Name: Gomez, Jason

Tel: (970) 573-1277

COGCC contact:

Email: jason.gomez@state.co.us

API Number 05-123-14532-00

Well Name: CARLSON

Well Number: 2

Location: QtrQtr: NESE Section: 14 Township: 5N Range: 65W Meridian: 6

County: WELD

Federal, Indian or State Lease Number: 65540

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.396944

Longitude: -104.623889

GPS Data:

Date of Measurement: 05/03/2010

PDOP Reading: 2.2

GPS Instrument Operator's Name: Chuck Kraft

Reason for Abandonment: ☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes☐ No

Estimated Depth: 550

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks: ☐ Yes☒ No

If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6931	6941			

Total: 1 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	316	160	316	0	VISU
1ST	7+7/8	3+1/2	9.3	7,058	225	7,058	5,964	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6881 with 2 sacks cmt on top. CIBP #2: Depth 6620 with 2 sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 220 sks cmt from 600 ft. to 0 ft. Plug Type: STUB PLUG Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged: ☐

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Carlson 2 (05-123-14532)/Plugging Procedure (Intent)
Producing Formation: Codell 6931'-6941'
TD: 7100' PBD: 7005'
Surface Casing: 8 5/8" 24# @ 316' w/ 160 sxs
Production Casing: 3 1/2" 9.3# @ 7058' w/ 225 sks cmt (TOC 5964' - CBL)

Tubing: 2 1/16" 3.25 #/ft IJ tubing set at 6883'. (5/4/2008)

Proposed Procedure:

1. MIRU RU pulling unit. Pull 2 1/16" tubing.
2. RU wireline company.
3. TIH with CIBP. Set CIBP at 6881'. Top with 2 sxs 15.8#/gal CI G cement.
4. TIH with CIBP. Set CIBP at 6620'. Top with 2 sxs 15.8#/gal CI G cement.
5. TIH with casing cutter. Cut 3 1/2" casing at 550'. Recover 3 1/2" casing.
6. TIH with tubing to 600'. Mix and pump 220 sxs of 15.8#/gal CI G cement down tubing. Cement should circulate to surface.
7. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Jenifer Hakkarinen

Title: Reg Tech Date: 10/13/2016 Email: JEnifer.Hakkarinen@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

CONDITIONS OF APPROVAL, IF ANY:

Expiration Date: 4/24/2017

COA Type**Description**

	1) Provide 48 hour notice of plugging MIRU via electronic Form 42. 2) For the 600' plug: pump plug and displace. If surface casing plug is not circulated to surface then tag plug – must be at 266' or shallower and provide 10 sx plug at the surface. Leave at least 100' of cement in the casing for each plug. 3) Properly abandon flowlines as per Rule 1103. File electronic Form 42 once abandonment complete. 4) Prior to initiation of plugging operations, a Bradenhead test shall be performed. If any pressure remains at the conclusion of the test or any liquids were present call COGCC Engineer for sampling requirements. Form 17 shall be submitted within 10 days.
--	--

Attachment Check List**Att Doc Num****Name**

401104917	FORM 6 INTENT SUBMITTED
401130337	WELLBORE DIAGRAM
401130338	WELLBORE DIAGRAM

Total Attach: 3 Files

General Comments**User Group****Comment****Comment Date**

Permit	Passed completeness.	10/17/2016 7:44:11 AM
Permit	Returned to draft. Can't open WBD docnum 401117080.	10/5/2016 12:38:11 PM
Permit	Returned to draft. Still can't open WBD docnum 401117080.	9/28/2016 4:57:15 PM
Permit	Missing Wellbore Diagrams.	9/21/2016 4:40:37 PM
Public Room	Document verification complete 09/08/16	9/8/2016 9:33:40 AM

Total: 5 comment(s)