

Document Number:
401406562

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175 Contact Name: Kelsi Welch
 Name of Operator: PDC ENERGY INC Phone: (303) 831-3974
 Address: 1775 SHERMAN STREET - STE 3000 Fax: _____
 City: DENVER State: CO Zip: 80203 Email: kelsi.welch@pdce.com

For "Intent" 24 hour notice required, Name: Pesicka, Conor Tel: (970) 415-0789
 COGCC contact: Email: conor.pesicka@state.co.us

API Number 05-123-21378-00 Well Number: 23-11
 Well Name: WELLS RANCH
 Location: QtrQtr: NESW Section: 11 Township: 5N Range: 63W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: _____
 Field Name: WATTENBERG Field Number: 90750

Notice of Intent to Abandon Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.412500 Longitude: -104.406150
 GPS Data:
 Date of Measurement: 10/31/2006 PDOP Reading: 3.4 GPS Instrument Operator's Name: Holly L. Tracy
 Reason for Abandonment: Dry Production Sub-economic Mechanical Problems
 Other _____
 Casing to be pulled: Yes No Estimated Depth: 620
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6602	6608			
NIOBRARA	6432	6437			
J SAND	7052	7056	08/14/2003	BRIDGE PLUG	6990

Total: 3 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	413	290	413	0	
1ST	7+7/8	4+1/2	10.5	7,279	430	7,279	2,775	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6990 with 2 sacks cmt on top. CIBP #2: Depth 6382 with 2 sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 200 sks cmt from 670 ft. to 0 ft. Plug Type: STUB PLUG Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged:
Set _____ sacks at surface
Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No
Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____
*Wireline Contractor: _____ *Cementing Contractor: _____
Type of Cement and Additives Used: _____
Flowline/Pipeline has been abandoned per Rule 1103 Yes No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Wells Ranch 23-11 (05-123-21378)/Plugging Procedure (Intent)
Producing Formation (Perforations): Niobrara: 6432'-6437' Codell: 6602'-6608' J-Sand: 7052'-7056'
TD: 7289' PBD: 7265'
Surface Casing: 8 5/8" 24# @ 413' w/ 290 sxs
Production Casing: 4 1/2" 10.5# @ 7279' w/ 430 sxs cmt (TOC @ 2775' - CBL). Existing CIBP @ 6990'.

Tubing: Unknown.

Proposed Procedure:

1. MIRU pulling unit. Pull tubing, if present.
2. RU wireline company.
3. Load dump bailer with 2 sxs of 15.8#/gal CI G cement. TIH with dump bailer and spot on top of existing CIBP @ 6990'.
4. TIH with CIBP. Set BP at 6382'. Top with 2 sxs 15.8#/gal CI G cement.
5. TIH with casing cutter. Cut 4 1/2" casing at 620'. Pull cut casing.
6. TIH with tubing to 670'. RU cementing company. Mix and pump 200 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface.
7. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Kelsi Welch
Title: Production Tech Date: _____ Email: kelsi.welch@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____

Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: _____

COA Type **Description**

--	--

Attachment Check List

Att Doc Num **Name**

401406602	WELLBORE DIAGRAM
401406603	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

User Group **Comment**

Comment Date

		Stamp Upon Approval
--	--	---------------------

Total: 0 comment(s)