

Engineer: Clark Martin  
Cell Phone Number: 970-371-4601

## PLUG and ABANDONMENT PROCEDURE

### DEL CAMINO 11-14

#### Description

1. Provide 48 hour notice to COGCC prior to rig up per request on approved Form 6 (e.g. call field coordinator, submit Form 42, etc.). Notify Automation Removal Group at least 24 hours prior to rig move. Request they catch and remove plunger, isolate production equipment, and remove any automation prior to rig MIRU.
2. MIRU Slickline. Pull production equipment and tag bottom. Record tag depth in Open Wells. Gyro was run on 05/21/13. RDMO Slickline.
3. Prepare location for base beam equipped rig. Install perimeter fence as needed.
4. Verify COAs before RU.
5. Upon RU, check and record bradenhead pressure. If bradenhead valve is not accessible, re-plumb so that valve is above GL. Blow down bradenhead and re-check pressure the next day. Repeat until pressure stays at 0 psi.
6. MIRU WO rig. Spot a min of 0 jts of 2-3/8" 4.7#, J-55, EUE tbg. Kill well as necessary using biocide treated fresh water. ND WH. NU BOP. Unland tbg using unlanding joint and LD.
7. TOOH and SB 7100' 2-3/8" tbg. LD any remainder.
8. MIRU WL. PU and RIH with (4-1/2", 11.6#) gauge ring to 7820'. POOH.
9. PU and RIH with (4-1/2", 11.6#) CIBP and set at +/- 7810' (collars at 7802' & 7844'). POOH. RIH and dump 2 sx cement on CIBP. POOH.
10. PU and RIH with (4-1/2", 11.6#) CIBP and set at +/- 7100' (collars at 7690' & 7742'). POOH. RDMO WL.
11. TIH with 2-3/8" tbg to 7100'
12. Load hole with biocide treated fresh water and circulate all gas out of well. PT CIBP to 500psi for 15 minutes.
13. MIRU Cementers. Pump Niobrara Balance Plug: Pump 25 sx (6.9 bbl or 39 cf), assuming 15.8 ppg & 1.53 cf/sk. Volume based on 400' inside 4-1/2", 11.6# production casing with no excess. Cement will be from 7100'-6700'. RD Cementers.
14. Slowly pull out of the cement. Reverse circulate using biocide treated fresh water to ensure the tubing is clean. TOOH, SB 1005' 2-3/8" tbg. LD remaining tbg.
15. MIRU WL. PU and RIH with (4-1/2", 11.6#) CIBP and set at +/- 4000' (collars at 3970' & 4012'). POOH. RIH and dump 2 sx cement on CIBP. POOH.
16. RIH and jet cut 4-1/2", 11.6# casing at 905'. RDMO WL.
17. Attempt to establish circulation and circulate (71 bbl) with fresh water containing biocide to remove any gas.
18. ND BOP. ND TH. Un-land casing using a casing spear, not a lifting sub. Rig max pull shall be 100,000#. Max pull over string weight shall be 50,000#. If unable to unland, contact Engineering.
19. Install BOP on casing head with 4-1/2", 11.6# pipe rams.
20. TOOH and LD all 4-1/2", 11.6# casing. Remove 4-1/2", 11.6# pipe rams and install 2-3/8" pipe rams.
21. TIH with mule shoe and 2-3/8" tubing to 1005'.

22. Establish circulation to surface with biocide treated fresh water and pump at least three hole-volumes (217.5 bbl) to circulate all gas out of the well. Contact engineering if evidence of gas migration persists.
23. RU Cementers. Pump 10 bbls (min) of pre-flush, followed by 5 bbls fresh water spacer. Pump GAS BLOK Stub Plug: 70 sx (14.5 bbl or 82 cf) with 0.25 lb/sk Polyflake, assuming 15.8 ppg & 1.16 cf/sk. Volume is based on 100' in 4-1/2", 11.6# production casing with no excess, 100' in 7.88" bit size with 100% excess factor. The plug is designed to cover 1005'-805'. RDMO Cementers. Notify engineering if circulation is ever lost during job.
24. Slowly pull out of the cement. SB tbg while TOO H to 410'. SD and WOC per cementing company guidelines, verify gas migration has been eliminated. If evidence of fluid migration or pressure remains, contact engineering for an update to plugging procedure.
25. TIH to tag Open Hole Plug. Establish circulation to surface with biocide treated fresh water.
26. RU Cementers. Pump 10 bbls (min) of pre-flush, followed by 5 bbls fresh water spacer. Pump GAS BLOK Stub Plug: 140 sx (28.7 bbl or 161 cf) TXI cement with 0.25 lb/sk Polyflake, assuming 14 ppg & 1.15 cf/sk. Volume is based on 129' in 7.88" bit size with 100% excess factor, and 201' in the 8-5/8", 24# surface casing with no excess. The plug is designed to cover 805'-475'. RDMO Cementers. Notify engineering if circulation is ever lost during job.
27. Slowly pull out of the cement and TOO H to 100'. Reverse circulate using biocide treated fresh water to ensure the tubing is clean. TOO H, LD all 2-3/8" tbg.
28. Tag cement as needed. After tagging top of cement, and verifying appropriate coverage above the surface casing shoe, pressure test surface casing to 500 psi and hold for 15 minutes.
29. MIRU WL. RIH 8-5/8", 24# CIBP to 80'. RDMO WL and WO rig.
30. Instruct cementing and wireline contractors to e-mail copies of all job logs/job summaries to [rscDJVendors@anadarko.com](mailto:rscDJVendors@anadarko.com) within 24 hours of completion of the job.
31. Supervisor submit paper copies of all invoices, logs, and reports to VWP Engineering Specialist.
32. Excavation crew to notify One Call to clear excavation area around wellhead and for flow lines.
33. Capping crew will set and secure night cap on 8-5/8", 24# casing head, restrain the casing head, pressure test CIBP to 500 psi with hydrotest pump, then remove night cap and casing head restraints.
34. Excavate hole around surface casing enough to allow welder to cut casing a minimum 5' below ground level.
35. Welder cut casing minimum 5' below ground level.
36. Fill casing to surface using 4500 psi compressive strength cement (NO gravel).
37. Spot weld on steel marker plate. Marker should contain Well name, Well number, legal location (1/4 1/4 descriptor) and API number.
38. Obtain GPS location data as per COGCC Rule 215 and send to [rscDJVendors@anadarko.com](mailto:rscDJVendors@anadarko.com).
39. Properly abandon flow lines per Rule 1103. File electronic Form 42 once abandonment is complete.
40. Back fill hole with fill. Clean location, and level.
41. Submit Form 6 to COGCC ensuring to provide 'As performed' WBD identifying operations completed.