

**FORM  
INSP**Rev  
X/15**State of Colorado  
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203  
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

07/03/2019

Submitted Date:

07/03/2019

Document Number:

696101124**FIELD INSPECTION FORM**
 Loc ID 453331 Inspector Name: Evins, Bret On-Site Inspection ☐ 2A Doc Num:           
**Operator Information:**OGCC Operator Number: 10261Name of Operator: BAYSWATER EXPLORATION & PRODUCTION LLCAddress: 730 17TH ST STE 500City: DENVER State: CO Zip: 80202**Status Summary:**

- ☒ THIS IS A FOLLOW UP INSPECTION
- ☒ FOLLOW UP INSPECTION REQUIRED
- ☐ NO FOLLOW UP INSPECTION REQUIRED

**Findings:**8 Number of Comments1 Number of Corrective Actions☒ Corrective Action Response Requested**ANY CORRECTIVE ACTION(S) FROM  
PREVIOUS INSPECTIONS THAT HAVE NOT  
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
,		wellinspections@bayswater.us	<a href="#">All Inspections</a>
Pesicka, Conor		conor.pesicka@state.co.us	

**Inspected Facilities:**

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
453331	LOCATION	AC			-	G & D Hanks 27-N Pad	AC

**General Comment:**

This is a FLOWBACK Inspection  
Follow-up to Field Inspection Report Doc. #696100026 dated 01/30/2019.

Location				
<b>Lease Road:</b>				
	Type	Access		
	comment:	Adequate		
Corrective Action	L		Date:	
Overall Good: <input type="checkbox"/>				
<b>Signs/Marker:</b>				
	Type	BATTERY		
	Comment:			
Corrective Action:			Date:	
Emergency Contact Number:				
	Comment:			
Corrective Action:				Date: _____
Overall Good: <input type="checkbox"/>				
<b>Spills:</b>				
Type	Area	Volume		
In Containment: No				
	Comment:			
<input type="checkbox"/> Multiple Spills and Releases?				
<b>Equipment:</b>				
				corrective date
Type:	Emission Control Device	# 1		
Comment:	Prior insp: Flowback vapor recovery line had been disconnected prior to this inspection in an attempt to thaw the line. Some condensate spilled onto the adjacent ground staining the soil. SE corener of site. Soil is currently dry. Properly treat and/or remove oily waste. Refer to Rule 907.e for guidance. Original Corrective Action date: 03/01/2019.  This insp: * Stained soil at SE corner of site NOW appears to be mitigated. See photos #7, 8.			
Corrective Action:				Date:
Type:	Other	# 1		
Comment:	Prior insp: East Flowback tanks do NOT appear to be properly grounded. Special Equipment requirements. Refer to Rule 605.c for guidance. Properly ground flowback tanks. Comply with Rule 605.c. Original Corrective Action date: 03/01/2019.  This insp: * East flowback tanks NOW appear removed from site. See photos #3, 4.			
Corrective Action:				Date:
Type:	Other	# 1		

Comment:	<p>Prior insp: Transfer Pump w/ internal combustion engine. Appears to be approximately 15 feet from northwest corner of flowback tanks bank. Fire Prevention and Protection. Implement actions to fully comply with Rule 606A.b regarding fire prevention and protection. (7 days for equipment positioning). Move Transfer pump to a safe distance from flowback tanks bank. Comply with Rule 606A.b. Original Corrective Action date: 02/06/2019.</p> <p>This insp: * Transfer Pump w/ internal combustion engine NOW appears to have been removed from site. See photos #5, 6.</p>		
Corrective Action:		Date:	

**Venting:**

Yes/No	NO		
Comment:			
Corrective Action:		Date:	

**Flaring:**

Type		
Comment:		
Corrective Action:		Date:

**Inspected Facilities**Facility ID: 453331 Type: LOCATION API Number: - Status: AC Insp. Status: AC**Completion**Operation: FlowbackDate Flowback: 07/03/2019

Contractor:

Comment: West Flowback tanks do NOT appear to be properly grounded. Grounding rod NOT connected to tanks.  
Special Equipment requirements. Refer to Rule 605.c for guidance.  
See photos #1, 2.

Corrective Action: Properly ground West flowback tanks. Comply with Rule 605.c.  
Corrective Action date: 08/02/2019.

Date: 08/02/2019

**Reclamation - Storm Water - Pit**

**Storm Water:**

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment
Gravel		Gravel				

Comment:

Corrective Action:

Date:

**Pits:** ☐ NO SURFACE INDICATION OF PIT

**COGCC Comments**

Comment	User	Date
<p>COGCC Inspection Report Summary:</p> <p>On WED 07/03/2019 at approximately 10:31 hrs. I, Bret Evins, conducted an on-site inspection at:  Operator Name: BAYSWATER EXPLORATION &amp; PRODUCTION LLC  Location Name: G &amp; D Hanks /27-N Pad  Location ID: 453331  Location County: Weld County, Colorado  Weather: Dry</p> <p>While there, I observed: Facility: Flowback operations  Battery SE Corner GPS coordinates: 40.541746, -104.760623</p> <p>Follow-up to Field Inspection Report Doc. #696100026 dated 01/30/2019.  3 of 3 Corrective Actions appears addressed.</p> <p>1.) Transfer Pump w/ internal combustion engine. Appears to be approximately 15 feet from northwest corner of flowback tanks bank.  Fire Prevention and Protection. Implement actions to fully comply with Rule 606A.b regarding fire prevention and protection. (7 days for equipment positioning).  Move Transfer pump to a safe distance from flowback tanks bank. Comply with Rule 606A.b.  Original Corrective Action date: 02/06/2019.  * Transfer Pump w/ internal combustion engine NOW appears to have been removed from site.  See photos #5, 6.</p> <p>2.) Flowback vapor recovery line had been disconnected prior to this inspection in an attempt to thaw the line. Some condensate spilled onto the adjacent ground staining the soil. SE corner of site. Soil is currently dry.  Properly treat and/or remove oily waste. Refer to Rule 907.e for guidance.  Original Corrective Action date: 03/01/2019.  * Stained soil at SE corner of site NOW appears to be mitigated.  See photos #7, 8.</p> <p>3.) East Flowback tanks do NOT appear to be properly grounded.  Special Equipment requirements. Refer to Rule 605.c for guidance.  Properly ground flowback tanks. Comply with Rule 605.c.  Original Corrective Action date: 03/01/2019.  * East flowback tanks NOW appear removed from site.  See photos #3, 4.</p> <p>1: NEW Corrective Actions observed on this inspection.  1.) West Flowback tanks do NOT appear to be properly grounded. Grounding rod NOT connected to tanks.  Special Equipment requirements. Refer to Rule 605.c for guidance.  Properly ground flowback tanks. Comply with Rule 605.c.  Corrective Action date: 08/02/2019.</p> <p>A follow up on this site inspection will be conducted to ensure the compliance issues have been corrected to comply with COGCC rules.</p> <p>This is a summary of the inspection report.</p>	evinsb	07/03/2019

**Attached Documents**

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
402096783	INSPECTION SUBMITTED	<a href="http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4868736">http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4868736</a>