

Location			
Lease Road:			
Type	Main		
comment:	Adequate		
Corrective Action			Date:
Overall Good: <input checked="" type="checkbox"/>			
Signs/Marker:			
Type	WELLHEAD		
Comment:	Adequate		
Corrective Action:			Date:
Type	BATTERY		
Comment:	Adequate		
Corrective Action:			Date:
Type	TANK LABELS/PLACARDS		
Comment:	Adequate		
Corrective Action:			Date:
Emergency Contact Number:			
Comment:	Adequate		
Corrective Action:			Date: _____
Good Housekeeping:			
Type	STORAGE OF SUPL		
Comment:	Unused equipment on the ground and on trailer.		
Corrective Action:	Please remove unused equipment. Per rule 603.f. Corrective action date 6/15/2020 See attached photos #4, 5 & 6		Date: <u>06/15/2020</u>
Overall Good: <input type="checkbox"/>			
Spills:			
Type	Area	Volume	
In Containment: No _____			
Comment: _____			
<input type="checkbox"/> Multiple Spills and Releases?			
Equipment:			
Type: Bird Protectors	# 3		corrective date
Comment:			
Corrective Action:			Date:
Type: Deadman # & Marked	# 4		
Comment:			
Corrective Action:			Date:
Type: Bradenhead	# 1		
Comment:	Appears to be plumbed to surface		

Corrective Action:		Date:	
Type: Vertical Heated Separator	#		
Comment:	Stained soil on west side of separator.		
Corrective Action:	Control and contain spills/releases and clean up per Rule 906.a. Corrective action date 6/15/2020 See attached photo #. 7	Date:	06/15/2020
Type: Pump Jack	# 1		
Comment:	Debris (dead weeds) around Pump		
Corrective Action:	Location is within a designated setback location, remove trash or debris per Rule 604.c.(2)P. Corrective Action Date6/5/2020 See attached photo #.2	Date:	06/05/2020
Type: Emission Control Device	# 1		
Comment:	Inadequate berms around separator house and EDC.		
Corrective Action:	Repair or install berms or other secondary containment devices per Rule 605.a.(4). Inadequate berms around tank(s) Corrective action Date 6/15/2020, see photo# 5	Date:	06/15/2020

Tanks and Berms:

Contents	#	Capacity	Type	Tank ID	SE GPS
CRUDE OIL	1	300 BBLs	STEEL AST		39.833505,-104.536458
Comment:	Bull plug missing from loadoff line.				
Corrective Action:	Location is within a designated setback location, bullplug or cap all loadlines per Rule #604.c.(2)O. Corrective action Date6/5/2020 See attached photo #. 8				Date:
Date: 06/05/2020					

Paint

Condition	Adequate
Other (Content)	
Other (Capacity)	
Other (Type)	

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Earth	Adequate	Walls Sufficient	Base Sufficient	Adequate
Comment:				
Corrective Action:				
				Date:

Contents	#	Capacity	Type	Tank ID	SE GPS
PRODUCED WATER	1	OTHER	Open Top		,
Comment:					
Corrective Action:					Date:

Paint

Condition	Adequate
Other (Content)	
Other (Capacity)	140bbbls
Other (Type)	

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Earth	Adequate	Walls Sufficient	Base Sufficient	Adequate

Comment:	Shears berm with crude tank.	
Corrective Action:		Date:

Venting:

Yes/No	NO		
Comment:			
Corrective Action:		Date:	

Flaring:

Type		
Comment:		
Corrective Action:		Date:

Inspected Facilities

Facility ID: 202061 Type: WELL API Number: 001-07466 Status: SI Insp. Status: SI

Idle Well

Purpose: Shut In Temporarily Abandoned Reminder: _____

Comment:

Corrective Action: Date: _____

BradenHead

Comment:

Corrective Action: Date: _____

COGCC Comments

Comment	User	Date
<p>COGCC Inspection Report Summary On Thursday May 14th, 2020 at approximately 10:15am, I, Inspector Chane Finkenbinder, conducted an on-site inspection at Farm Ranch Exploration Behrns Resources INC, at API # 001-07466 in Adams County Colorado. While there, I observed a Shut In well. During this inspection the following possible compliance issues were observed: Stained soil on west side of separator. Control and contain spills/releases and clean up per Rule 906.a. Corrective action date 6/15/2020 See attached photo #. 7 Unused equipment on the ground and on trailer. Please remove unused equipment. Per rule 603.f. Corrective action date 6/15/2020 See attached photos #4, 5 & 6 Bull plug missing from loadoff line. Location is within a designated setback location, bullplug or cap all loadlines per Rule #604.c.(2)O. Corrective action Date 6/5/2020 See attached photo #. 8 Debris (dead weeds) around Pump Jack. Location is within a designated setback location, remove trash or debris per Rule 604.c.(2)P. Corrective Action Date 6/5/2020 See attached photo #.2 Inadequate berms around separator house and EDC. Repair or install berms or other secondary containment devices per Rule 605.a.(4). Inadequate berms around tank(s) Corrective action Date 6/15/2020, see photo# 5 A follow up on this site inspection needs to be conducted to ensure the compliance issues have been corrected to comply with COGCC rules. This is a summary of inspection report.</p>	finkenbc	05/22/2020

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
700900096	Inspection photos	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5157639