

FORM

6

Rev  
02/20

## State of Colorado

## Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

402430821

Date Received:

06/25/2020

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 100322

Contact Name: Kevin Monaghan

Name of Operator: NOBLE ENERGY INC

Phone: (970) 3812990

Address: 1001 NOBLE ENERGY WAY

Fax:

City: HOUSTON State: TX Zip: 77070

Email: kevin.monaghan@nblenergy.com

For "Intent" 24 hour notice required,

Name:

Tel:

COGCC contact:

Email:

Type of Well Abandonment Report:



Notice of Intent to Abandon



Subsequent Report of Abandonment

API Number 05-123-11405-00

Well Name: LUNDVALL

Well Number: 9

Location: QtrQtr: NENW

Section: 18

Township: 5N

Range: 66W

Meridian: 6

County: WELD

Federal, Indian or State Lease Number: 62949

Field Name: WATTENBERG

Field Number: 90750

## Only Complete the Following Background Information for Intent to Abandon

 
Latitude: 40.405000

Longitude: -104.825180

GPS Data: GPS Quality Value: 2.2 Type of GPS Quality Value: Date of Measurement: 06/28/2007

GPS Instrument Operator's Name: Paul Tappy

Reason for Abandonment:


☐ Other

Casing to be pulled:



Estimated Depth:

Fish in Hole:



If yes, explain details below

Wellbore has Uncemented Casing leaks:



If yes, explain details below

Details:

## Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7378	7397	10/31/2019	B PLUG CEMENT TOP	7328

Total: 1 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	292	200	292	0	VISU
1ST	7+7/8	4+1/2	11.6	7,487	250	7,487	6,218	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7328 with 2 sacks cmt on top. CIBP #2: Depth 7015 with 10 sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set <u>10</u> sks cmt from <u>7015</u> ft. to <u>6883</u> ft.	Plug Type: <u>CASING</u>	Plug Tagged: <input type="checkbox"/>
Set <u>220</u> sks cmt from <u>2550</u> ft. to <u>1904</u> ft.	Plug Type: <u>STUB PLUG</u>	Plug Tagged: <input checked="" type="checkbox"/>
Set _____ sks cmt from _____ ft. to _____ ft.	Plug Type: _____	Plug Tagged: <input type="checkbox"/>
Set _____ sks cmt from _____ ft. to _____ ft.	Plug Type: _____	Plug Tagged: <input type="checkbox"/>
Set _____ sks cmt from _____ ft. to _____ ft.	Plug Type: _____	Plug Tagged: <input type="checkbox"/>

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 292 sacks half in. half out surface casing from 588 ft. to 0 ft. Plug Tagged: ☒

Set 15 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: 2500 ft. of 4+1/2 inch casing Cut and Cap Date: 01/30/2020

\*Wireline Contractor: SPN

\*Cementing Contractor: Ranger Energy Services

Type of Cement and Additives Used: Class G Neat

Flowline/Pipeline has been abandoned per Rule 1105 ☒ Yes ☐ No

Technical Detail/Comments:

Form 17 DocNum: 402229925  
Form 42 DocNum: 402216748  
Form 44 DocNum: 402362829

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Lindsay Rodriguez

Title: Regulatory Analyst Date: 6/25/2020 Email: denverregulatory@nblenergy.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: Jacobson, Eric Date: 11/4/2020

### CONDITIONS OF APPROVAL, IF ANY:

COA Type	Description

### Attachment Check List

**Att Doc Num****Name**

402430821	FORM 6 SUBSEQUENT SUBMITTED
402430836	CEMENT BOND LOG
402430837	CEMENT JOB SUMMARY
402430838	OPERATIONS SUMMARY
402430839	WELLBORE DIAGRAM
402430840	WIRELINE JOB SUMMARY

Total Attach: 6 Files

### General Comments

**User Group****Comment****Comment Date**

		Stamp Upon Approval
--	--	------------------------

Total: 0 comment(s)