

FORM  
INSPRev  
X/20State of Colorado  
Oil and Gas Conservation Commission1120 Lincoln Street, Suite 801, Denver, Colorado 80203  
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

08/25/2022

Submitted Date:

08/29/2022

Document Number:

696204016

## FIELD INSPECTION FORM

 Loc ID: 322320 Inspector Name: Trujillo, Aaron On-Site Inspection:  2A Doc Num:
**Status Summary:**

- THIS IS A FOLLOW UP INSPECTION
- FOLLOW UP INSPECTION REQUIRED
- NO FOLLOW UP INSPECTION REQUIRED

**Operator Information:**
 OGCC Operator Number: 51130  
 Name of Operator: LOCIN OIL CORPORATION  
 Address: 600 TRAVIS ST STE 6161  
 City: HOUSTON State: TX Zip: 77002
**Findings:**

- 13 Number of Comments
- 6 Number of Corrective Actions
- Corrective Action Response Requested

**ANY CORRECTIVE ACTION(S) FROM PREVIOUS INSPECTIONS THAT HAVE NOT BEEN ADDRESSED ARE STILL APPLICABLE**

**Contact Information:**

Contact Name	Phone	Email	Comment
Nicol, Michael	281-362-8600x116	mnicol@locinoil.com	All inspections
Pesicka, Conor		conor.pesicka@state.co.us	

**Inspected Facilities:**

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
210271	WELL	SI	06/01/2020	GW	045-06027	GOVERNMENT 1	RI
322320	LOCATION	AC			-	GOVERNMENT-66S104W 35SWSW	RI

**General Comment:**

On 8/25/2022, Reclamation Specialist Trujillo inspected Locin Oil Corporations' Government #1 Location in Garfield County, Colorado.

This inspection is a follow-up to #696202842 to document compliance with the following corrective actions:

- Secondary Containment
- Weeds

Records show Well/Location transferred ownership to Locin Oil Corp #51130, effective 3/1/2022.

The following compliance issues were observed during this inspection:

- Signage (tanks, tank battery, well, etc..)
- Weeds
- Stormwater

Refer to the "Location" section of this inspection report for additional details.

Refer to the photo-documentation of the observed compliance issues attached to this report.

Any corrective action(s) from previous inspections that have not been addressed are still applicable.

A follow up inspection on this site will be conducted to ensure the compliance issues have been corrected to comply with COGCC rules.

<b>Location</b>			
<b>Lease Road:</b>			
	Type	Access	
	comment:	It was observed in this inspection that stormwater, erosion control and stabilization BMPs are missing or insufficient along entire access road- erosion degradation and sediment transport evident. Road provides access to Locin Oil Corp's Government 1, Government 2, as well as Utah Gas Corp's Federal Carbonera 1-2 Locations. Corrective action is being provided to all 3 Locations.	
	Corrective Action:	Comply with 1002.f.; Implement and maintain BMPs to control stormwater runoff in a manner that minimizes erosion, transport of sediment offsite, and site degradation on access road. Ensure controls are implemented in accordance with good engineering practices and maintained in proper functioning condition; regrading alone will not be sufficient to stabilize road and manage runoff.	Date: <u>09/13/2022</u>
Overall Good: <input type="checkbox"/>			
<b>Signs/Marker:</b>			
	Type	BATTERY	
	Comment:	Sign not posted or information inaccurate at battery; incorrect Operator information.	
	Corrective Action:	Install sign to comply with Rule 605.e.	Date: <u>09/29/2022</u>
	Type	WELLHEAD	
	Comment:	Sign not posted or information inaccurate at well; incorrect Operator information.	
	Corrective Action:	Install sign to comply with Rule 605.d.	Date: <u>09/29/2022</u>
	Type	TANK LABELS/PLACARDS	
	Comment:	Signage/labels at the three tanks on the Location not posted or information is inaccurate.	
	Corrective Action:	Comply with 605.h and post/label on all tanks with a capacity of 10 Barrels or greater, with the following information: A. Name of Operator; B. Operator's emergency contact telephone number; C. Tank capacity; D. Tank contents; and E. NFPA label or equivalent globally harmonized label. Lettering on all new Tanks, and on any reapplied or modified labels, will be legible from a distance of 100 feet.	Date: <u>09/29/2022</u>
Emergency Contact Number:			
	Comment:	Emergency contact numbers listed on sign is for Foundation Energy; emergency contact information inaccurate. See CA for signage information above.	
	Corrective Action:		Date:
<b>Good Housekeeping:</b>			
	Type	WEEDS	
	Comment:	Undesirable Plant Species (Russian thistle) observed establishing on the working pad areas, and along the access road	
	Corrective Action:	Comply with Rule 606.c and keep Location and access road free of Undesirable Plant Species.	Date: <u>09/05/2022</u>
Overall Good: <input type="checkbox"/>			
<b>Spills:</b>			
	Type	Area	Volume
		Tank	<= 1 bbl
	Comment:	Dark fluids observed within the secondary containment of the methanol tank next to well.	
	Corrective Action:	Remove and properly dispose fluids within containment.	Date: <u>09/13/2022</u>
In Containment: Yes			
	Comment:	<input style="width: 100%;" type="text"/>	
<input type="checkbox"/> Multiple Spills and Releases?			

<b>Fencing/:</b>			
Type	TANK BATTERY		
Comment:	Panels		
Corrective Action:		Date:	
Type	WELLHEAD		
Comment:	Panels		
Corrective Action:		Date:	

**Tanks and Berms:**

Contents	#	Capacity	Type	Tank ID	SE GPS
Comment:					
Corrective Action:					Date:

**Paint**

Condition	
Other (Content)	
Other (Capacity)	
Other (Type)	

**Berms**

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
		Walls Sufficient	Base Sufficient	Adequate
Comment:	Weeds/vegetation have been removed from the secondary containment BMP, and work to ensure BMP remains impervious has been conducted.			
Corrective Action:				Date:

**Venting:**

Yes/No	
Comment:	
Corrective Action:	Date:

**Flaring:**

Type	
Comment:	
Corrective Action:	Date:

**Inspected Facilities**

Facility ID: 210271 Type: WELL API Number: 045-06027 Status: SI Insp. Status: RI

Facility ID: 322320 Type: LOCATION API Number: - Status: AC Insp. Status: RI

**COGCC Comments**

Comment	User	Date
<p>Collaborate with Utah Gas Corp regarding necessary work to comply with 1002.f along access road, between the turn-off of CR 201 and the Federal-Carbonera 1-2. Locin Oil remains responsible for maintenance of the road leading north of the Fed.-Car. 1-2, to the Government #1 and #2 Locations.</p> <p>Refer to inspection nos. 696204020 and 696204018 for additional details.</p>	trujilloam	08/29/2022

**Attached Documents**

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
403150053	INSPECTION SUBMITTED	<a href="http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5842214">http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5842214</a>
696204017	Inspection Photos	<a href="http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5842207">http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=5842207</a>