

FORM  
6Rev  
11/20

# State of Colorado Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Document Number:

403351869

Date Received:

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 47120

Contact Name: Lindsay Davis

Name of Operator: KERR MCGEE OIL &amp; GAS ONSHORE LP

Phone: (970) 515-1616

Address: P O BOX 173779

Fax:

City: DENVER State: CO Zip: 80217-

Email: Lindsay\_Davis@oxy.com

For "Intent" 24 hour notice required,

Name: Silver, Randy

Tel: (720) 827-6688

COGCC contact:

Email: randy.silver@state.co.us

Type of Well Abandonment Report: ☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

API Number 05-123-27359-00

Well Name: KIRKMEYER

Well Number: 10-25

Location: QtrQtr: NWSE Section: 25 Township: 1N Range: 68W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

### Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.020860

Longitude: -104.949630

GPS Data: GPS Quality Value: 2.0 Type of GPS Quality Value: Date of Measurement: 09/21/2007

Reason for Abandonment: ☐ Dry ☒ Production Sub-economic ☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes ☐ No Estimated Depth: 1185Fish in Hole: ☐ Yes ☒ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details:

### Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7904	7922			
NIOBRARA	7502	7768			

Total: 2 zone(s)

### Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J-55	24	0	1085	760	1085	0	VISU
1ST	7+7/8	4+1/2	L-80	11.6	0	8497	465	8497	4410	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7436 with 2 sacks cmt on top. CIBP #2: Depth 260 with 80 sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 15 sks cmt from 4694 ft. to 4550 ft. Plug Type: CASING Plug Tagged: ☐  
Set 10 sks cmt from 2260 ft. to 2180 ft. Plug Type: CASING Plug Tagged: ☐  
Set 10 sks cmt from 1310 ft. to 1230 ft. Plug Type: CASING Plug Tagged: ☐  
Set 80 sks cmt from 260 ft. to 0 ft. Plug Type: CASING Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at 4755 ft. with 100 sacks. Leave at least 100 ft. in casing 4694 CICR Depth

Perforate and squeeze at 2800 ft. with 185 sacks. Leave at least 100 ft. in casing 2260 CICR Depth

Perforate and squeeze at 2000 ft. with 225 sacks. Leave at least 100 ft. in casing 1310 CICR Depth

(Cast Iron Cement Retainer Depth)

Set 120 sacks half in. half out surface casing from 1185 ft. to 1035 ft. Plug Tagged: ☐

Set 80 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☒ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing

Surface Plug Setting Date: \_\_\_\_\_ Cut and Cap Date: \_\_\_\_\_ Number of Days from Setting Surface Plug to Capping or Sealing the Well: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_

\*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

## BMPs

### Signage for P&As:

Prior to commencing operations, KMG will post signs in conspicuous locations. The signs will indicate plugging and abandonment operations are being conducted, the well name, well, and the Operator's contact information. Signs will be placed so as not to create a potential traffic hazard.

### Notifications:

Courtesy notifications will be sent to all parcel owners with building units within 1,500 feet of the location letting them know about out plugging and abandonment operations and providing contact information for Kerr McGee's response line and online resources.

### Wellbore Pressure:

In some cases, wellbore pressure drawdown operations may occur approximately 1-2 days prior to Move In Rig Up (MIRU) of the workover rig. This is conducted to allow for reduced time that the workover rig is needed on location. These operations will be conducted in accordance with Form 4 and/or Form 6 requirements.

### Water:

Water will be placed on dirt access roads to mitigate dust as needed.

### Lighting:

Operations are daylight-only; no lighting impacts are anticipated from operations.

### Noise:

Operations will be in compliance with Table 423-1 requirements. Based off the rig sound signature, rig orientation will be considered to reduce noise levels to nearby building units.

### Environmental Concerns:

This location was reviewed using a desktop method to review publicly available wildlife data (including CPW & COGCC data) as well as internal wildlife datasets and aerial imagery. All field personnel are trained to identify wildlife risks and raise concerns noticed during operations with the KMOG Health, Safety, and Environment (HSE) department.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Lindsay Davis  
Title: Regulatory Tech Date: \_\_\_\_\_ Email: Lindsay\_Davis@oxy.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_ Date: \_\_\_\_\_

### CONDITIONS OF APPROVAL, IF ANY:

Expiration Date: \_\_\_\_\_

### COA Type

### Description

0 COA	

## Attachment List

### Att Doc Num

### Name

403351893	PROPOSED PLUGGING PROCEDURE
403351894	WELLBORE DIAGRAM

Total Attach: 2 Files

## General Comments

### User Group

### Comment

### Comment Date

		Stamp Upon Approval
--	--	---------------------

Total: 0 comment(s)