

**FORM
INSP**Rev
X/20**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

09/19/2023

Submitted Date:

09/21/2023

Document Number:

708300916

FIELD INSPECTION FORMLoc ID 324088 Inspector Name: Morris, Matthew On-Site Inspection ☐ 2A Doc Num: _____**Operator Information:**

OGCC Operator Number: 96850

Name of Operator: TEP ROCKY MOUNTAIN LLC

Address: 1058 COUNTY ROAD 215

City: PARACHUTE State: CO Zip: 81635

Status Summary:

- ☒ THIS IS A FOLLOW UP INSPECTION
- ☒ FOLLOW UP INSPECTION REQUIRED
- ☐ NO FOLLOW UP INSPECTION REQUIRED

Findings:

8 Number of Comments

1 Number of Corrective Actions

☒ Corrective Action Response Requested**ANY CORRECTIVE ACTION(S) FROM
PREVIOUS INSPECTIONS THAT HAVE NOT
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
, TEP		COGCCInspectionReports@terraep.com	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
256587	WELL	PR	04/01/2021	GW	045-07473	AMERICAN SODA GM 263-2	PR

General Comment:**COGCC Inspection Report Summary**

On 9/19/2023 at approximately 11:25, Compliance Inspector Matthew Morris conducted an on-site inspection at TEP ROCKY MOUNTAIN LLC, AMERICAN SODA-67S96W/2SWW at Location ID #324088 in Garfield County, Colorado.

Normal production operations were observed.

During the inspection, the following compliance issues were observed:

1) Stormwater; refer to Stormwater section

A follow-up on this site inspection will be conducted to ensure the compliance issues have been corrected to comply with COGCC rules.

This location is within or in close proximity to, a CPW Density/High Priority Habitat, Black Bear, NSO Habitat, or Wildlife Management area.

LocationOverall Good: ☐

Signs/Marker:			
Type	WELLHEAD		
Comment:			
Corrective Action:		Date:	
Type	BATTERY		
Comment:			
Corrective Action:		Date:	
Type	OTHER		
Comment:	Separator units include attached storage tanks. The sight glass on the side of the unit indicates that the storage tank contains an unknown fluid. No form of labeling or markers is present to identify a potential hazard or the contents of the storage tank.		
Corrective Action:		Date:	
Type	TANK LABELS/PLACARDS		
Comment:			
Corrective Action:		Date:	

Emergency Contact Number:

Comment: 911/(970) 285-9377

Corrective Action:

Date: _____

Overall Good: ☐

Spills:			
Type	Area	Volume	

In Containment: No

Comment:

☐ Multiple Spills and Releases?

Fencing/:			
Type	WELLHEAD		
Comment:	Pipe rail fencing		
Corrective Action:		Date:	
Type	SEPARATOR		
Comment:	Livestock fencing		
Corrective Action:		Date:	
Type	TANK BATTERY		
Comment:	Livestock fencing		
Corrective Action:		Date:	

Equipment:			corrective date
Type: Horizontal Heated Separator	# 1		
Comment:			
Corrective Action:		Date:	

Type: Gas Meter Run	# 1		
Comment:			
Corrective Action:			Date:
Type: Plunger Lift	# 1		
Comment:			
Corrective Action:			Date:
Type: Bird Protectors	# 2		
Comment:			
Corrective Action:			Date:
Type: Bradenhead	# 1		
Comment:			
Corrective Action:			Date:

Tanks and Berms:

Contents	#	Capacity	Type	Tank ID	SE GPS	
PRODUCED WATER	1	<100 BBLS	STEEL AST		,	
Comment:						
Corrective Action:						Date:

Paint

Condition	Adequate	
Other (Content)		
Other (Capacity)	80 bbls	
Other (Type)		

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Metal	Adequate	Walls Sufficent	Base Sufficent	Adequate
Comment:				
Corrective Action:				
			Date:	

Venting:

Yes/No	NO		
Comment:			
Corrective Action:			Date:

Flaring:

Type		
Comment:		
Corrective Action:		Date:

Inspected Facilities									
Facility ID:	256587	Type:	WELL	API Number:	045-07473	Status:	PR	Insp. Status:	PR
Producing Well									
Comment:									
Corrective Action:								Date:	

Reclamation - Storm Water - Pit

Storm Water:

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment
		Check Dams				
Seeding						
		Other	Fail			Insufficient erosion controls
		Retention Ponds				
Compaction						
Rip Rap						
		Compaction				
Berms						
		Other				
		Ditches				
		Sediment Traps				
		Rip Rap				
Sediment Traps						
		Gravel				
		Culverts				
		Berms				
Gravel						
Ditches						

Comment: [Insufficient erosion controls; rill erosion cutting through access road.](#)

Corrective Action: [Oil and gas operators shall implement and maintain Best Management Practices \(BMPs\) at all oil and gas locations to comply with Rule 1002.](#)

Date: 10/06/2023

Pits: ☒ NO SURFACE INDICATION OF PIT

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
403538123	INSPECTION SUBMITTED	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=6260363
708300931	Photo Log	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=6260358