

**FORM
INSP**Rev
X/20**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

10/09/2023

Submitted Date:

10/11/2023

Document Number:

699107552**FIELD INSPECTION FORM**Loc ID 331746 Inspector Name: Burns, Adam On-Site Inspection ☐ 2A Doc Num: _____**Operator Information:**OGCC Operator Number: 65110Name of Operator: O'BRIEN ENERGY RESOURCES CORPAddress: 18 CONGRESS ST STE 207City: PORTSMOUTH State: NH Zip: 03801**Status Summary:**

- ☒ THIS IS A FOLLOW UP INSPECTION
- ☒ FOLLOW UP INSPECTION REQUIRED
- ☐ NO FOLLOW UP INSPECTION REQUIRED

Findings:7 Number of Comments4 Number of Corrective Actions☒ Corrective Action Response Requested**ANY CORRECTIVE ACTION(S) FROM
PREVIOUS INSPECTIONS THAT HAVE NOT
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
Forma, Joseph	603-427-2099 x111	joeforma@obenergy.com	All Inspections

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
331746	LOCATION	AC			-	NORTH LOST CREEK- 63N62W 17SWSE	AC

General Comment:[Inspection on the tank battery](#)[This is a follow up to prior inspection document #699107152. CA's have not been corrected.](#)

LocationOverall Good: ☐

Emergency Contact Number:

Comment:

Corrective Action:

Date: _____

Good Housekeeping:

Type	UNUSED EQUIPMENT		
Comment:	Unused equipment in multiple spots needs to be removed for good housekeeping. See attached photos		
Corrective Action:	Comply with Rule 606.	Date:	09/22/2023
Type	OTHER		
Comment:	Stained soil in front of the East tank needs to be removed for good housekeeping. See attached photo.		
Corrective Action:	"Properly dispose of oily waste in accordance with 905.e."	Date:	09/22/2023

Overall Good: ☐**Spills:**

Type	Area	Volume		
------	------	--------	--	--

In Containment: No

Comment:

☐ Multiple Spills and Releases?**Equipment:**

			corrective date
Type: Other	#		
Comment:	Unmarked risers need marked. See attached photos		
Corrective Action:	. Upon removing a flowline or crude oil transfer line from use with the intent to abandon, an operator must immediately apply OOSLAT to the risers. OOSLAT must stay in place at all times during the process of abandoning the flowline or crude oil transfer line until the operator removes the riser. Comply with Rule 1105.b		Date: 09/22/2023

Venting:

Yes/No			
Comment:			
Corrective Action:		Date:	

Flaring:

Type		
Comment:		
Corrective Action:		Date:

Inspected Facilities

Facility ID: 331746 Type: LOCATION API Number: - Status: AC Insp. Status: AC

Idle Well

Purpose: ☒ Shut In ☐ Temporarily Abandoned

Reminder: _____

Comment: SI Tank Battery
No FIRR was submitted

Corrective Action: When a Field Inspection Report includes a corrective action, upon completion of that corrective action the Operator will submit to the Director a Field Inspection Report Resolution Form ("FIRR"). Per rule 210.b.

Date: 10/13/2023

COGCC Comments

Comment	User	Date
<p>ECMC Inspection Report Summary</p> <p>On Tuesday 8/8/23 at approximately 1006hrs I, Inspector Adam Burns, Conducted an on-site inspection to prior inspection document #699107152 at North Lost Creek-63N62W 17SWSE Tank Battery of O'Brien Energy Resources Corp. Location ID #331746 in Weld County, Colorado.</p> <p>During this inspection the following possible compliance issues were observed:</p> <p>Unused equipment in multiple spots needs to be removed for good housekeeping. Comply with Rule 606. With a Corrective Action date of 9/22/23</p> <p>Stained soil in front of the East tank needs to be removed for good housekeeping. "Properly dispose of oily waste in accordance with 905.e." With a Corrective Action date of 9/22/23</p> <p>Unmarked risers need marked. Upon removing a flowline or crude oil transfer line from use with the intent to abandon, an operator must immediately apply OOSLAT to the risers. OOSLAT must stay in place at all times during the process of abandoning the flowline or crude oil transfer line until the operator removes the riser. Comply with Rule 1105.b. With a Corrective Action date of 9/22/23</p> <p>No FIRR was submitted. When a Field Inspection Report includes a corrective action, upon completion of that corrective action the Operator will submit to the Director a Field Inspection Report Resolution Form ("FIRR"). Per rule 210.b. With a Corrective Action date of 10/13/23</p> <p>No CA's were corrected</p> <p>A follow up on this site inspection needs to be conducted to ensure the compliance issues have been corrected to comply with ECMC rules.</p> <p>This is a summary of the inspection report.</p>	burnsa	10/11/2023

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
403557341	INSPECTION SUBMITTED	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=6281161
699107553	Inspection Photos	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=6281135