

Interim Reclamation and Stormwater Inspection

February 10, 2023

Operator: UPLAND EXPLORATION LLC- #10701

Location ID: 462908

Inspection Document #: 697504503

Weld County, CO

NESE Section 21 T11N R64W

Chris Binschus
Reclamation Specialist, COGCC



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

Inspection Photos

Location Name: Little Lady 21/North Well Pad

Location ID: 462908

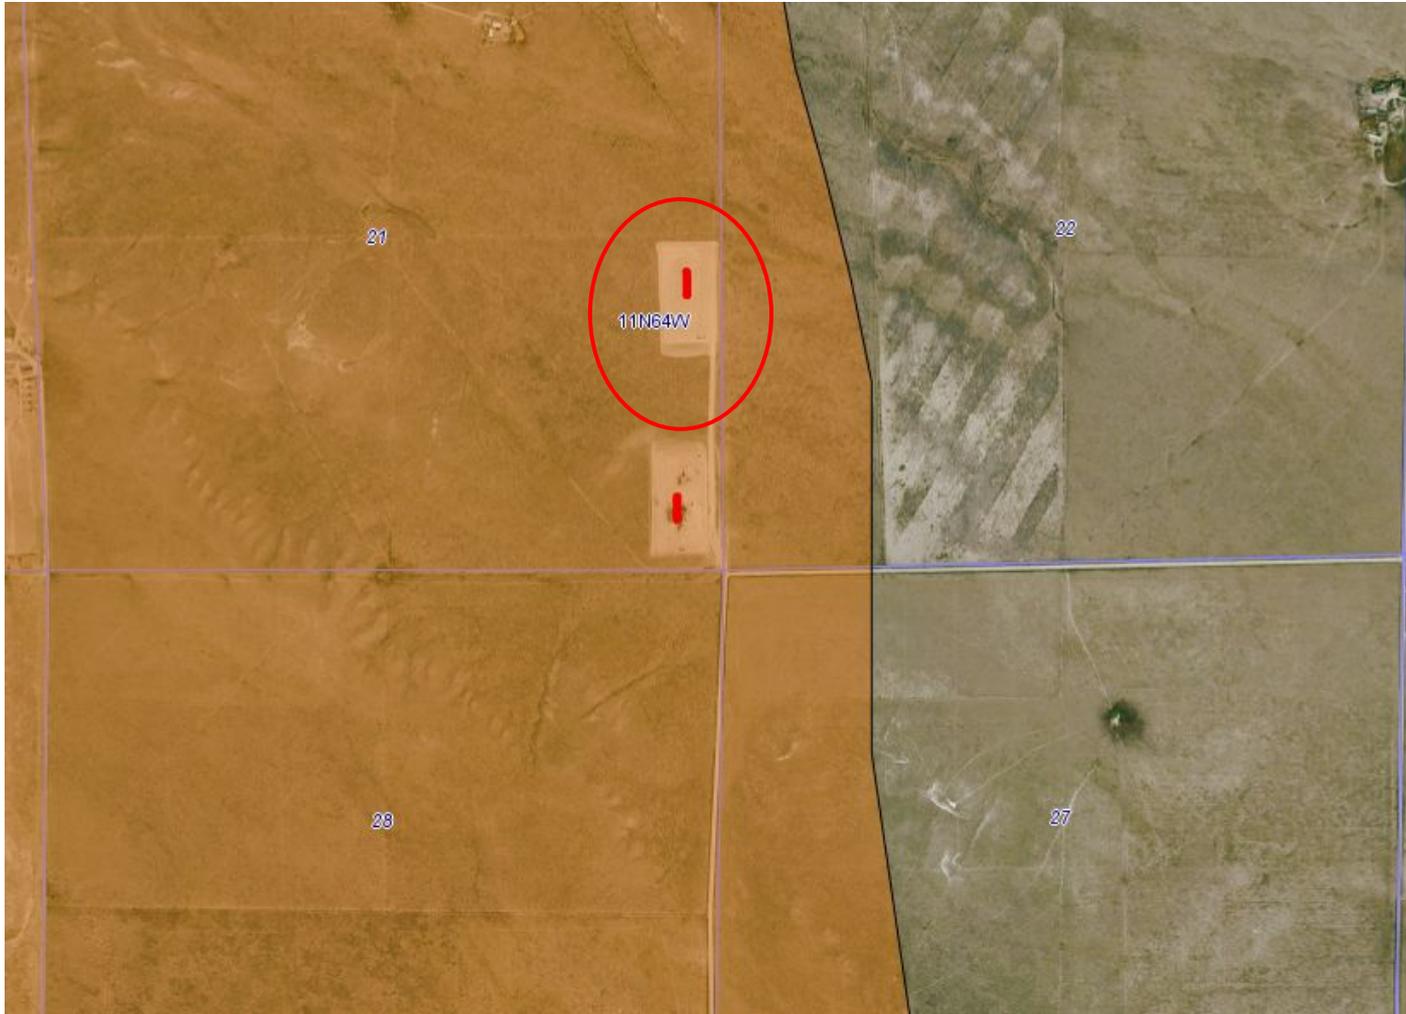


Photo 1. Photo illustrates the access road and location of the Little Lady locations are within a Pronghorn Winter Concentration area.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

Inspection Number: 697504503

Inspection Photos

Location Name: Little Lady 21/North Well Pad

Location ID: 462908



Photo 2. COGCC GISOnline aerial imagery from 2019 illustrates the location. At the time of this inspection, the location remains the same size and interim reclamation has not been performed- refer to Photos 4-5.

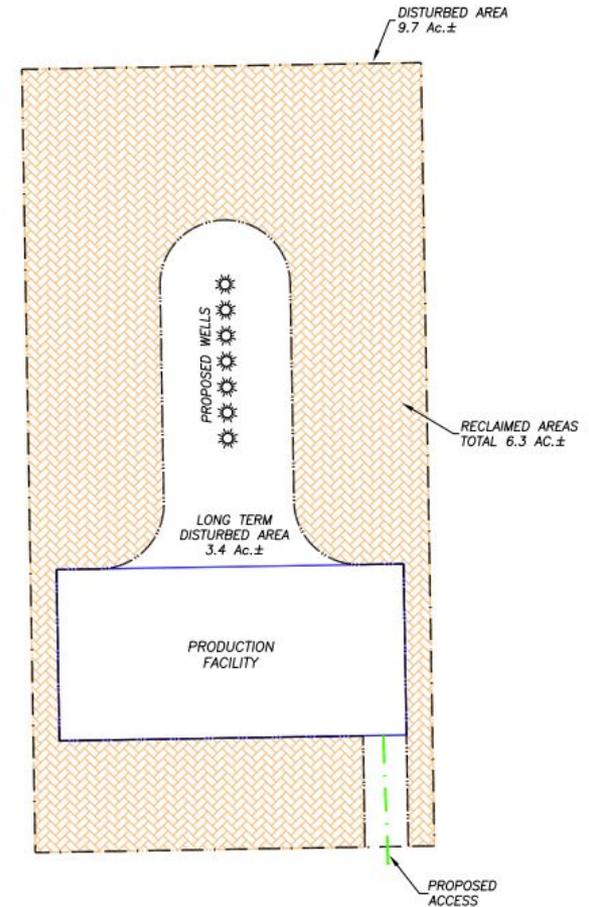


Photo 3. The image is from the Operator's Construction Layout Drawing illustrating the proposed interim reclamation plan, which has failed to be performed.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

Inspection Number: 697504503

Inspection Photos
Location Name: Little Lady 21/North Well Pad
Location ID: 462908



Photo 4. Photo taken from the southern location, facing West. Photo illustrates interim reclamation has not been performed.



Photo 5. Photo taken from the southern location, facing North. See comments under Photo 4.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

Inspection Number: 697504503

Inspection Photos
Location Name: Little Lady 21/North Well Pad
Location ID: 462908



Photo 6. Photo taken from the southeastern location, facing East. Photo illustrates trash being stored on location.

Note- weeds were observed along the eastern perimeter of location.



Photo 7. Photo taken from the southeastern location, facing Northeast. Photo illustrates debris and equipment being stored on location.

Note- weeds were observed along the eastern perimeter of location.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

Inspection Number: 697504503

Inspection Photos
Location Name: Little Lady 21/North Well Pad
Location ID: 462908



Photo 8. Photo taken from the northeastern location, facing Northeast. Photo illustrates chemicals being stored on location.



Photo 9. Photo taken from the wellheads, facing North. See comments under Photos 6 & 7.



Inspection Photos
Location Name: Little Lady 21/North Well Pad
Location ID: 462908



Photo 10. Photo taken from the wellheads, facing East. See comments under Photos 6 & 7.



Photo 11. Photo taken from the northwestern location, facing North. See comments under Photos 6 & 7.

Note- weeds were observed around the wellhead area.

Inspection Photos
Location Name: Little Lady 21/North Well Pad
Location ID: 462908



Photo 12. Photo taken from the western location. Photo illustrates stained soil/spill related to the compressor.



Photo 13. Photo taken from the western location. Photo illustrates spills within secondary containment. Remove and properly dispose fluids from within the secondary containment.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

Inspection Number: 697504503

Inspection Photos

Location Name: Little Lady 21/North Well Pad

Location ID: 462908



Photo 14. Photo taken from the western location. Photo illustrates a hose left hooked up which could contribute to a potential spill.



Photo 15. Photo taken from the southern location, facing West. Photo illustrates the topsoil stockpile which is primarily bare or has weedy, annual vegetation with minimal perennial vegetation that would not meet the standard.



COLORADO

Oil & Gas Conservation
Commission

Department of Natural Resources

Inspection Number: 697504503